


SQUARE NUTS



Nominal or Basic Major Dia. Of Thread	F			G		H		
	Width Across Flats			Width Across Corners		Thickness		
	Basic	Max	Min	Max	Min	Basic	Max	Min
1/4 0.2500	7/16	0.438	0.425	0.619	0.584	7/32	0.235	0.203
5/16 0.3125	9/16	0.562	0.547	0.795	0.751	17/64	0.283	0.249
3/8 0.3750	5/8	0.625	0.606	0.884	0.832	21/64	0.346	0.310
7/16 0.4375	3/4	0.750	0.728	1.061	1.000	3/8	0.394	0.356
1/2 0.5000	13/16	0.812	0.788	1.149	1.082	7/16	0.458	0.418
5/8 0.6250	1	1.000	0.969	1.414	1.330	35/64	0.569	0.525
3/4 0.7500	1-1/8	1.125	1.088	1.591	1.494	21/32	0.680	0.632
7/8 0.8750	1-5/16	1.312	1.269	1.856	1.742	49/64	0.792	0.740
1 1.0000	1-1/2	1.500	1.450	2.121	1.991	7/8	0.903	0.847
1-1/4 1.2500	1-7/8	1.875	1.812	2.652	2.458	1-3/32	1.126	1.062
1-1/2 1.5000	2-1/4	2.250	2.175	3.182	2.956	1-5/16	1.348	1.276

ASME/ANSI B18.2.2

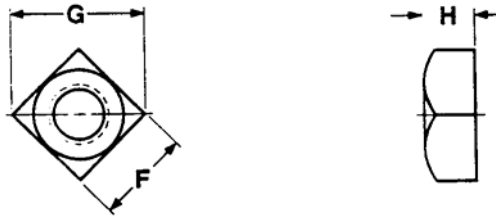